



Singles	<i>Simples</i>
Singles with Socket	<i>Simples avec étrier</i>
Ganged-stereo	<i>Jumelés stéréo</i>
Ganged-multiples	<i>Jumelés multiples</i>
Duals	<i>Doubles</i>
Dual-multiples	<i>Doubles multiples</i>

With Rotary Switch	<i>Avec interrupteur rotatif</i>
With Push-push Switch	<i>Avec interrupteur push-push</i>



Click-stops types	<i>Types avec cran de position</i>
Dust-proof types	<i>Types étanche à la poussière</i>
Edge Control Potentiometers	<i>Potentiomètres à molette</i>

Mounting Bushes	<i>Canons de montage</i>
Spindle variations	<i>Variations de l'axe</i>
Normalised spindles	<i>Axes normalisés</i>
Position of the taps	<i>Position des prises</i>
Mounting accessories	<i>Ecrous et rondelles</i>

How to order	<i>Désignation pour passer une commande</i>
--------------	---



Carbon Rotary Potentiometers - 16 mm size

Singles

Types
CIP160C
P160C

Mechanical data



Rotation angle:	$270^\circ \pm 5^\circ$
Operating torque:	$0.4 \div 1.5 \text{ Ncm}$
Permissible torque at end stop:	35 Ncm max
Permissible axial spindle load:	50 N (5 sec max)
Tap:	Z2 at 50% of rotation
Weight, std. spindle:	~ 6 g

Optional features

- Central click
- Rotation angle $300^\circ \pm 5^\circ$: types **CIP162C** and **P162C**
- 11 click-stops: types **CIR11P162C** and **R11P162C**



viewed on component side

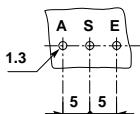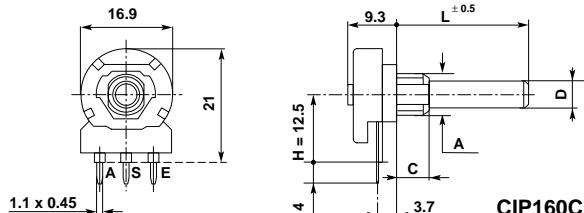

- Optional terminations
- $H = 15 \text{ mm}$
 - 9.3 mm instead of 4 mm for $H = 12.5$ only

Types

CIP160C	P.c. terminations
P160C	Solder tag terminations

Standard spindle & bush

$D = 4 \text{ mm}$; $L = 32 \text{ mm}$, plastic, F21 type
 $A = M7 \times 0.75$; $C = 6 \text{ mm}$, C type

Spindle and bushing variations

D mm	Available types				
	Plastic spindle	Metal spindle	Bush	C = mm	A = mm
4	F21, F22, F23, F25	M21, M22, M23, M25	C, CE	6 - 9	M7x0.75
			CEP	4.5 - 8	M7x0.75
6	F31, F32, F33, F34, F35	M31, M32, M33, M34, M35	C, CE	6 - 9	M7x0.75
			CEP	4.5 - 8	M7x0.75
	F1, F2, F3, F4, F5, F6, F10, F11, F12	NOT	KC	8	M10x0.75
			C9	6	M9x0.75

Spindle and bushing details, chassis piercing: see p. 79 to 83.

Normalised spindles: see p. 84.